## **DETAILS OF INSPECTION VIOLATIONS**

NO.	LOCATION	REF.	POINTS	CRITICAL	DESCRIPTION
1	MAIN GALLEY DECK # 5-WAREWASHER	37	0	No	
HEAVY CONDENSATION WAS NOTED ON THE DECKHEAD AT THE DIRTY END OF THE WAREWASHER.					
Condensation was rectified and the deck head area is being kept dry					
2	DECKS # 4&3 MAIN GALLEY ICE DISPENSERS	20	2	No	
THE METAL ICE DISPENSER LEVER AT THE COKE DISPENSER HAD LOOSE PLASTIC PEELING FROM THE SURFACE.					
Coca Cola will replace the metal Ice dispenser levers with plastic ones within 2 weeks.					
3	DECKS # 3&4 MAIN GALLEY-BREAD SLICERS	20	2	No	
THE J	OILED BREAD SLICERS WERE STORED AS CLEAN. THE MACHINES ARE DIFFICULT DB. THE MACHINES SHOULD BE CLEANED AFTER EVERY USE AS STATED ON THE D TO BE CLEANED TWICE A WEEK.				
	pread slicer is being cleaned daily. We are looking into the poss be more easily cleanable.	ibility c	of purchasi	ng another	bread slicer that
4	DECK #4 MAIN GALLEY BAKERY	28	0	No	
	ELT ON THE DOUGH ROLLER SHOULD BE PROVIDED WITH A BRACE TO ALLOW THACHINE TO PROPERLY AIR DRY AFTER CLEANING.	IE NON-F	OOD CONTAC	T AREA OF TH	E BELT AND
A bra	ace was constructed in order to allow the non-food contact area	of the	belt to air	dry.	
5	PROVISIONS-DAIRY	33	0	No	
THE V	ENT ON THE DECKHEAD AREA HAD A WATER LEAKAGE.				
	has been documented as a Guarantee claim; meanwhile the Re ation to prevent condensation build up and resulting water leak	_	neer will tr	y to install a	additional
6	PROVISIONS	38	0	No	
	LEANING LOCKER NEXT TO THE MEAT PREPARATION AREA HAD MOPS STORED IN ERLY AIR DRY. SANITIZING BUCKETS WERE NOT STORED INVERTED.	N A MANN	IER THAT DID	NOT ALLOW TI	НЕМ ТО
	mops are now stored in a manner, which allows them to be proped inverted.	oerly ai	r-dried. Th	e sanitizing	buckets are
7	MEDICAL	*	0	No	
	ECOMMENDED THAT A SPACE BE PROVIDED ON THE QUESTIONIARE FOR CREW M WORK IN FOR BETTER TRACKING PURPOSES IN THE EVENT OF AN ILLNESS OUTB		TO IDENTIFY \	WHAT DEPARTI	MENT
	se a separate list to track crew members sick listed with GI sym department but also their station assignment and room mates.	ptoms,	which help	s us not jus	st to identify
8	WINDJAMMER GALLEY - DISHWASH	22	0	No	
	NAL RINSE GAUGE TEMPERATURE ON THE CONVEYOR GLASSWASH MACHINE RELATE LEVEL TEMPERATURE WAS 166 °F. THE MANUFACTURERS DATA PLATE ALS ) °F.				
	ort Technical Department was informed about this issue, they will der to get this fixed or at least to get the preliminary report for t				ugust 23, 2003,
9	WINDJAMMER GALLEY - DISHWASH	22	0	No	

THE FINAL RINSE GAUGE TEMPERATURE FOR THE IN-USE CONVEYOR DISHWASH MACHINE REGISTERED 202  $^{\circ}$ F, WHILE THE PLATE LEVEL READING WAS 166  $^{\circ}$ F. THE ENGINEER REPORTED THAT THE CALIBRATION OF THE GAUGE IS CORRECT, BUT THE PROBE FOR THE GAUGE WAS LOCATED NEAR THE BOOSTER HEATER, RATHER THAN AT THE MANIFOLD FOR THE FINAL RINSE.

Same case at a different location, again we are waiting for the preliminaries of the guarantee visit.

# 10 WINDJAMMER BEVERAGE STATIONS A SERVER AT ONE BEVERAGE STATION WAS OBSERVED OPENING A HALF-PINT MILK CARTON WITH BARE HANDS CONTACTING THE SPOUT. THE TWO OTHER HALF-PINT MILKS POSITIONED IN THE ICE BATH HAD BOTH SPOUTS OPENED FULLY. THIS COFFEE COUNTER WAS OPEN FOR PASSENGER SELF-SERVICE, AND THEY WERE OBSERVED HANDLING THESE MILK CONTAINERS TO POUR INTO CUPS OF COFFEE AND TEA. AT A SECOND BEVERAGE STATION, TWO OF THE 3 FULL CARTONS WERE COMPLETELY CLOSED AND ANOTHER WAS OPENED AND FOLDED CLOSED, INDICATING THAT PASSENGERS WERE MANIPULATING THE SERVING SPOUT WITH THEIR HANDS.

We have changed the procedure. Larger milk containers will be placed on the counters and refilled by crewmembers during the service. The milk will be subjected to time constraints so no guest or crew will need to touch or open and close the milk containers at the beverage stations.

### 11 WINDJAMMER BUFFET - PORT/AFT HOT ISLAND

3 0 No

THE DECORATIVE SUSPENDED DECKHEAD DIRECTLY ABOVE THIS BUFFET HOT ISLAND (PORT/AFT SECTION) WAS HEAVILY SOILED WITH DUST DEBRIS ALONG THE LOWER SURFACES.

Surfaces have been cleaned and will be cleaned regularly.

12WHIRLPOOL SPAS 10 0 No

THERE WAS NO MONTHLY CORE SAMPLING OF THE WHIRLPOOL SPA SAND FILTERS TO TEST FOR EXCESSIVE ORGANIC MATERIAL ACCUMULATIONS. A RECOMMENDED TEST METHOD WAS LEFT WITH THE SHIP STAFF TO REVIEW OR IMPLEMENT.

We have implemented this monthly core testing for the sand, we did a test on August 19, 2003, with satisfactory results, we will keep these samples until the next change of sand.

13 **POOLS/SPAS** 10 0 No

THE HALOGEN RESIDUAL TEST KIT (EXTECH) IN USE FOR POOL AND SPA CHLORINE TESTING IN THE RANGE OF 0-10 PPM WAS DESIGNED FOR TOTAL CHLORINE TESTING ONLY. IT WAS BEING USED USED FOR FREE CHLORINE MEASUREMENTS.

The recommended test kit has been placed on order and will be in use once received onboard.

Page 2 of 3 DRAFT COPY

DRAFT COPY

# **DETAILS OF INSPECTION VIOLATIONS**

# NO. LOCATION 14 COMMENT \* 0 No CLEANLINESS OF POTS, PANS, DISHWARE, AND UTENSILS WAS EXCELLENT. RECORDKEEPING IN FOOD AREAS, POTABLE WATER,

0

No

HOUSEKEEPING, AND PEST MANAGEMENT WERE ALSO VERY STRONG TODAY.

IN DEVELOPING THE CORRECTIVE ACTION STATEMENT FOR THIS INSPECTION, CRITICAL-ITEM DEFICIENCIES (DESIGNATED WITH YES IN CRITICAL COLUMN (WORTH 3 - 5 POINTS), WHETHER DEBITED OR NOT, SHOULD INCLUDE STANDARD OPERATING PROCEDURES AND MONITORING PROCEDURES IMPLEMENTED TO PREVENT THE RECURRENCE OF THE CRITICAL DEFICIENCY.

PREPARE CORRECTIVE ACTION STATEMENT AS A WORD PROCESSING OR SPREADSHEET FILE WHICH WILL BE SENT TO USPHS / VSP AS AN EMAIL MESSAGE ATTACHMENT. PLEASE EMAIL CORRECTIVE ACTION STATEMENT TO: VSP@CDC.GOV

USE EMAIL MESSAGE SUBJECT LINE: SHIP NAME - CAS - [INSERT INSPECTION DATE].

COMMENT